

# TECHNICAL BULLETIN



**MODEL/DERIVATIVE:**  
Discovery series II (LT)

**Bulletin N°:** 0108  
**CDS. ref:** L8828bu  
**Issue:** 1  
**Date:** 23.10.02

**AFFECTED RANGE:**

All derivatives in the following VIN ranges: XA 218093 to 1A 299999  
1A 700000 onwards

**PROBLEM:**

**WATER INGRESS INTO REAR OF VEHICLE**

**CAUSE:**

Sealing operation between the roof and the rear header outer joint inadvertently omitted.


**ACTION:**

Where a complaint of the above is confirmed, follow the rectification procedure below to apply sealant between the roof and rear header outer joint.

**Rectification procedure**

1. Open the taildoor.
2. Release 17 clips securing the taildoor aperture secondary seal to the body, remove seal.
3. Clean between the roof and the rear header outer joint (see illustration 1).
4. Apply a continuous bead of sealant between the roof and the rear header outer joint (inset in illustration 1).
5. Wipe off any excess sealant.
6. Fit and secure the taildoor aperture secondary seal to the body.
7. Close the taildoor.

1

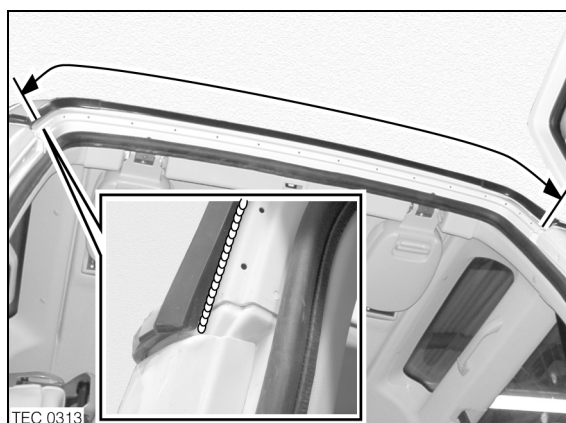

**PARTS INFORMATION:**

**Polyurethane sealant - locally sourced**

*WARRANTY CLAIMS:*

**Use Complaint Code: 9A2N**

**Use S.R.O.: 75.10.13**

**Time allowance: 0.20 Hrs**